



**NUMBER:** 08-011-06

**GROUP:** Electrical

**DATE:** March 02, 2006

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.*

**THIS BULLETIN IS BEING PROVIDED IN ADVANCE. DO NOT ORDER PARTS OR PERFORM ANY ACTIONS RELATED TO THIS BULLETIN UNTIL MARCH 10, 2006.**

**SUBJECT:**

Park Assist System - Warning Chime For Front Obstacle Detection Alerts Too Early

**OVERVIEW:**

This bulletin involves replacement of the Park Assist module

**MODELS:**

2006	(WH)	Grand Cherokee (International Markets)
2006	(XH)	Commander (International Markets)

**NOTE: This bulletin applies to vehicle built prior to January 16, 2006 (MDH 0116XX).**

**SYMPTOM/CONDITION:**

The customer may notice that the Park Assist warning chime may alert too early during front of vehicle obstacle detection. The Park Assist warning chime may start to alert during the amber LED illumination on the front display, rather than only during the red LED illumination. This condition involves only the front obstacle detection portion of the Park Assist system.

**DIAGNOSIS:**

If the customer experiences the above condition and the Park Assist Module software is at 05026017AC (or earlier), then perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
1	05026017AD	Module, Park Assist

**REPAIR PROCEDURE:**

1. Replace the Park Assist module located under the second row seat. For detailed repair procedures, refer to TechCONNECT: Service Info tab / 8 - Electrical / 8B - Chime Buzzer / Chime Buzzer - Service Information / Module - Park Assist / Removal and Installation.

**POLICY:**

Reimbursable within the provisions of the warranty.



**TIME ALLOWANCE:**

<b>Labor Operation No:</b>	<b>Description</b>	<b>Amount</b>
08-20-05-92	Module, Park Assist - Replace	0.2 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------